


# RPM TRANSMITTER

Model : TR-RPM1A4

ISO-9001, CE, IEC1010



PX-01 ( Optional )

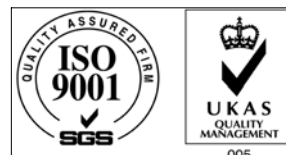

LUTRON ELECTRONIC

*The Art of Measurement*

# RPM

# TRANSMITTER

Model : TR-RPM1A4

|                              |  |  |
|------------------------------|--|--|
| <b>Measure Range</b>         | <i>Range 1 :</i><br>100-2,000RPM   | <i>Range 2 :</i><br>1,000 RPM - 20,000 RPM   |
| <b>Output</b>                | 4 - 20 mA  |  |
|                              | <i>Range 1 :</i><br>100 RPM = 4.8 mA<br>1,000 RPM = 12 mA<br>2,000 RPM = 20 mA | <i>Range 2 :</i><br>1,000 RPM = 4.8 mA<br>10,000 RPM = 12 mA<br>20,000 RPM = 20 mA |
| <b>External Adjustment</b>   | ZERO VR<br>SPAN VR   |  |
| <b>Power Supply</b>          | 90 - 260 ACV<br>50 Hz/60 Hz  |  |
| <b>Operation Temperature</b> | 0 - 50 °C<br>32 - 122 °F   |  |
| <b>Operation Humidity</b>    | Less than<br>80 %RH  |  |
| <b>Accessory Included</b>    | RPM sensor is optional.  |  |
| <b>Optional Accessories</b>  | Proximity sensor: PX-01<br>Photo sensor: PI-06                                 |  |
| <b>Mounting</b>              | Din rail or Wall   |  |
| <b>Case</b>                  | ABS plastic  |  |
| <b>Others</b>                | *3 wires connection<br>*Exciting voltage DC 12 V                               |  |

\* Appearance and specifications listed in this brochure are subject to change without notice.